

KS 50-1
Universal Industrial Controller

BluePort Front interface and BlueControl software

Maintenance manager and error list

Start-up circuit and boost function

Manual gain scheduling

Self-Tuning to the setpoint without oscillation

Monitoring of heating current and output circuit

3-point controller for water, fan and oil cooling

Type tested to the European *Pressure Equipment Directive* and cUL

- Universal continuous/switching version, i.e. reduced stocks
- 100 ms cycle time, i.e. also suitable for fast control loops
- Freely configurable analog output, e.g. as process value output
- Customer-specific linearization for all sensors
- Settings can be blocked via password and internal switch for high security
- Extended temperature range up to 60 °C allows mounting close to the process
- Easy 2-point or offset measurement correction
- Emergency operation after sensor break by means of the "output hold" function
- Logical combination of digital outputs, e.g. for general alarm
- Programmer with 4 segments and "end" signal
- RS 422/485 Modbus RTU interface
- Built-in transmitter power supply
- Splash-water proof front (IP 65)

APPLICATIONS

- Furnaces and ovens
- Burners and boilers
- Plastics processing
- ➤ Hot runners
- Driers
- Climatic chambers
- > Heat treatment plants

DESCRIPTION

The universal temperature controller KS 50-1 is intended for universal, precise, and cost-effective control tasks in all branches of industry. For this, the unit provides simple 2-point (on/off) control, continuous PID control, or 3-point stepping control. The process value signal is connected via a universal input. A supplementary analog input can be used for heating current measurement or as an external set-point input.

Every KS 50-1 has three process outputs that can be 3 relays or 2 relays plus a universal output. This universal output can be used for operating a solid-state relay, a continuous current/voltage output or to energize a two-wire transmitter. Optionally there are two additional opto coupler outputs.

The selectable function "start-up" ensure increased lifetime of high-performance electrical heating elements (e.g. hot runner moulds).

Plug-in module

KS 50-1 controllers are built as plug-in modules. This enables them to be replaced very quickly without tools, and without disturbing the wiring.

Self-tuning during start-up and to the setpoint

This new function determines the optimum settings for fast line-out without overshoot. With three-point controller configuration, the "cooling" parameters are determined separately, thus ensuring an optimum match to the process. By pushing a button the KS 50-1 determines the best control parameters at the actual setpoint. This function does not require oscillation, and performs a minimal deviation of the process value.

Display and operation

Clear information are given by ten indicator LEDs in the front panel that display operating mode, I/O states, and errors. The -key switches the controller into the manual mode directly. If required, the direct switch over can be disabled or the key can be configured e.g. reset the latched alarms. By the flexibly applicable function key an external switch can be omitted in many cases, because one can start now e.g. the boost function directly.

Front interface and Engineering Tools

Control parameter adjustment in seconds has now also been implemented in the KS 50 class of instruments. Via the BlueControl software incl. its simulation functions, and especially the convenient BluePort front panel interface, the required set-up

for a specific control task can be determined without a detailed study of the operating instructions.

Off cause almost all adjustments can be done comfortably over the instrument front. (see page 7, BlueControl)

Password protection

If required, access to the various operating levels can be protected with a password. Similarly, access to a complete level can be blocked.

TECHNICAL DATA

INPUTS

SURVEY OF THE INPUTS

| Input | Used for: |
|--------------|--|
| INP1 | x (process value) |
| INP2 | Heating current, ext. set-point |
| di1 | Operation disabled, switch-over |
| di2 (option) | to second set-point SP.2, external set-point SP.E, fixed |
| di3 (option) | correcting variable Y2, manual operation, controller off, disable auto/manual function, reset of stored alarms, boost, parameter set 1 ↔ 2 |

PROCESS VALUE INPUT INP1

Resolution: > 14 bit Decimal point: = 0 to 3 decimals

Limiting frequency: 2 Hz

Digital input filter: adjustable 0,000...9999 s

Scanning cycle: 100 ms

Measured value

correction: 2-point or offset correction

Thermocouples (Table 1)

 $\begin{array}{ll} \mbox{Input impedance:} & \geq 1 \mbox{ M}\Omega \\ \mbox{Effect of source resistance:} & 1 \mbox{ μV}/\Omega \end{array}$

Cold junction compensation

Max. additional error \pm 0,5 K

Sensor break monitoring

Sensor current: $\leq 1 \mu A$ Operating sense configurable (see page 4)

Resistance thermometer

 $\begin{array}{ll} \mbox{Connection:} & \mbox{3-wire} \\ \mbox{Lead resistance:} & \mbox{max. 30 } \Omega \\ \end{array}$

Input circuit monitor: Break and short circuit

Special measuring range

The BlueControl software can be used to match the input to the sensor KTY 11-6 (characteristic is stored in the controller).

Physical measuring range: $0...4500 \Omega$ Linearization segments 16

Table 1 Thermocouple ranges

| Therm | ermocouple Range | | Accuracy | Resolution (∅) | |
|-------|------------------|-------------|-------------|----------------|--------|
| L | Fe-CuNi (DIN) | -100900 °C | -1481652 °F | ≤ 2 K | 0,1 K |
| J | Fe-CuNi | -1001200 °C | -1482192 °F | ≤ 2 K | 0,1 K |
| K | NiCr-Ni | -1001350 °C | -1482462 °F | ≤ 2 K | 0,2 K |
| N | Nicrosil/Nisil | -1001300 °C | -1482372 °F | ≤ 2 K | 0,2 K |
| S | PtRh-Pt 10% | 01760 °C | 323200 °F | ≤ 2 K | 0,2 K |
| R | PtRh-Pt 13% | 01760 °C | 323200 °F | ≤ 2 K | 0,2 K |
| | special | -25` | 75 mV | ≤ 0,1 % | 0,01 % |

Table 2 Resistance transducers


| Туре | Sensor current | Rar | nge | Accuracy | Resolution (∅) |
|-----------|----------------|------------|-------------|----------|----------------|
| Pt100 | | -200850 °C | -3281562 °F | ≤1 K | 0,1 K |
| Pt1000 | 0,2 mA | -200200 °C | -328392 °F | ≤ 2 K | 0,1 K |
| KTY 11-6* | | -50150 °C | -58302 °F | ≤ 2 K | 0,05 K |

^{*} or special

Table 3 Current and voltage


| Range | Input resistance | Accuracy | Resolution (∅) |
|-----------|---|----------|----------------|
| 0-10 Volt | ≈ 110 kΩ | ≤ 0,1 % | 0,6 mV |
| 0-20 mA | 49 Ω (voltage requirement ≤ 2,5 V) | ≤ 0,1 % | 1,5 μΑ |

Electrical connections:

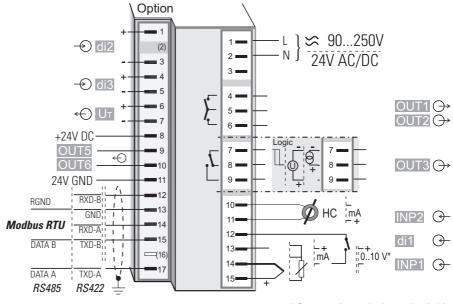

^{*} Pay attention to the internal switch!

Dimensions (mm):

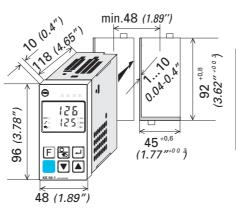

Galvanic isolations:

- Safety isolation
- Functional isolation

| Mains supply | Process value input INP1 Supplementary input INP2 Digital input di1 |
|----------------------|---|
| Relay outputs OUT1,2 | RS 422/485 interface |
| Relay output OUT3 | Digital inputs di2, 3 |
| | Universal output OUT3 |
| | Transmitter supply U _T |
| | OUT5, OUT6 |

2 KS 50-1

Current and voltage signals

Span start, end of span: anywhere within

measuring range

Scaling: selectable -1999...9999

Linearization: 16 segments, adaptable

with BlueControl

Decimal point: adjustable

Input circuit monitor: 12,5% below span start

(2mA, 1V)

SUPPLEMENTARY INPUT INP2

Resolution: > 14 bit Scanning cycle: 100 ms Accuracy: $\leq 0.5\%$

Heating current measurement

via current transformer

Measuring range: 0...50 mA AC

Scaling: adjustable -1999..0,000..9999 A

Current measurement range

Input resistance approx. 120 Ω Span: configurable within

0 to 20mA

Scaling: adjustable -1999...9999
Input circuit monitor: 12,5% below span start

 $(4..20\text{mA} \rightarrow 2\text{mA})$

CONTROL INPUT DI1

Configurable as direct or invers switch or push-button!

Connection of a potential-free contact suitable for switching "dry" circuits.

Switched voltage: 2,5 V Switched current: 50 μ A

CONTROL INPUTS DI2, DI3 (OPTION)

Configurable as switch or push-button! Optocoupler input for active triggering

Nominal voltage: 24 V DC, external Current sink (IEC 1131 Type 1)

Logic "0": -3...5 V
Logic "1": 15...30 V
Current requirement: approx. 5 mA

$TRANSMITTER SUPPLY U_T (OPTION)$

Output: $22 \text{ mA} / \ge 18 \text{ V}$

If the universal output OUT3 is used there may be no external galvanic connection between measuring and output circuits!

OUTPUTS

SURVEY OF THE OUTPUTS

| Used for | |
|---|---|
| Control output heating/cooling or Open/Close, limit contacts, alarms, programmer end * | |
| as OUT1 and OUT2 | |
| Control output, process value, set-point, control deviation, transmitter supply 13 V / 22 mA | |
| as OUT1 and OUT2 | OPTION |
| | Control output heating/cooling or Open/Close, limit contacts, alarms, programmer end * as OUT1 and OUT2 Control output, process value, set-point, control deviation, transmitter supply 13 V / 22 mA |

^{*} All logic signals can be OR-linked!

RELAY OUTPUTS OUT1, OUT2

Contacts: 2 NO contacts with common connection

Max. contact rating: 500 VA, 250 VAC, 2A at

48...62 Hz, resistive load

Min. contact rating: 6 V, 1 mA DC Duty cycle electric for I = 1A/2A: \geq

800,000 / 500,000 (at $\sim 250V /$ (resistive load))

OUT3 USED AS RELAY OUTPUT

Contacts: Potential-free changeover contact

Max. contact rating: 500 VA, 250 VAC, 2A at 48...62 Hz, resistive load

Min. contact rating: 5 V, 10 mA AC/DCDuty cycle electric 5 V, 10 mA AC/DCfor I = 1A/2A: $\geq 1,000,000 / 600,000 \text{ (at } \sim 250 \text{ V/ (resistive load))}$

Note:

If the relays OUT1...OUT3 operate external contactors, these must be fitted with RC snubber circuits to manufacturer specifications to prevent excessive switch-off voltage peaks.

OUT3 AS UNIVERSAL OUTPUT

Galvanically isolated from the inputs.

Freely scalable

Resolution: 11 bit

Current output

0/4...20 mA, configurable.

Signal range: 0...approx. 22 mA Load: $\leq 500 \,\Omega$ Load effect: none

Resolution: $\leq 22 \,\mu\text{A} (0.1\%)$ Error: $\leq 40 \,\mu\text{A} (0.2\%)$

Voltage output

0/2...10V, configurable

 $\begin{array}{ll} \mbox{Signal range:} & \mbox{0...11 V} \\ \mbox{Load:} & \geq 2 \mbox{ k} \Omega \\ \mbox{Load effect:} & \mbox{none} \end{array}$

Resolution: \leq 11 mV (0,1%) Error: \leq 20 mV (0,2%)

OUT3 used as transmitter supply

Output: $22 \text{ mA} / \ge 13 \text{ V}$

OUT3 used as logic output

Load \leq 500 Ω 0/ \leq 20 mA Load > 500 Ω 0/> 13 V

OUTPUTS OUT5, OUT6 (OPTIONAL)

Galvanically isolated opto-coupler outputs. Grounded load:

common positive control voltage. Output rating: 18...32 VDC; =70 mA Internal voltage drop: =1 V with I _{max} Protective circuit: built-in against short circuit, reversed polarity.

Node: For inductive load a free-wheel diode has to be connected externally.

KS 50-1 3

FUNCTIONS

Control behaviour

- Signaler with adjustable switching differential (ON/OFF controller)
- PID controller (2-point and continuous)
- Delta / Star / Off or 2-point controller with switch over from partial to full load
- 2 x PID (heating/cooling)
- 3-point stepping controller

Two parameter sets for manual gain scheduling

Self-tuning control parameters or adjustable manually via front keys or BlueControl software.

Behaviour with 2- and 3-point controllers

- Standard behaviour:
 - For precise matching of the required output value at the output signal limits, the controller changes the cycle times for heating and cooling automatically and continuously.
- With constant cycle times:
 The length of the shortest heating and cooling pulse is adjustable.
- Water cooling linear (heating=standard):

To ensure a sufficient cooling effect, the cooling function starts only after reaching an adjustable temperature value. The pulse length is adjustable, too and remains constant for all output values.


 Water cooling nonlinear (heating=standard):

The general function is described above but the controller additionally takes in consideration that the water cooling is usually much stronger than the heating (thus preventing unfavorable behavior when changing from heating to cooling).

Set-point functions


- Adjustable set-point gradient 0.01...9999 °C/min
- Set-point control
- Set-point/cascade control
- Program controller with 4 segments (set-point/section time)

Example of the linkage of the internal functions:

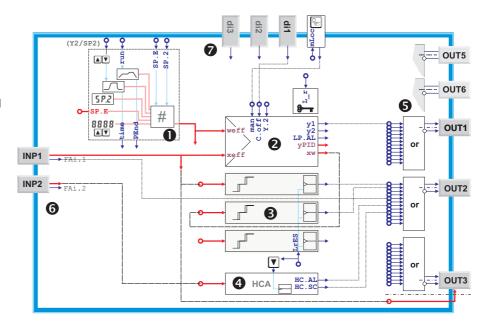


- setpoint processing with programmer, boost function and start-up circuit
- 2 controller function with loop monitoring
- 3 limit monitoring, configurable with latch and suppression
- 4 heating current monitoring
- output processing with logic or-combination and inverting
- 6 analog inputs with logical sensor fail signal
- digital inputs, function key and \subseteq -key with lock function

Modbus Master function supports setpoint changes e.g. in extruder applications

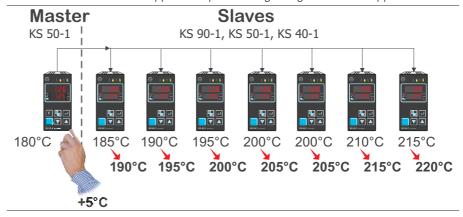

Behaviour with sensor break or short circuit:

- Control outputs switched off
- Switch-over to a safe output value
- Switch-over to a mean output value (PID controller)

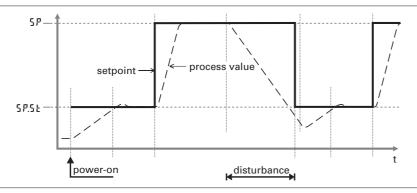

Start-up circuit

When the process is controlled towards the start-up set-point, the output value is limited. The start-up set-point is kept constant during the start-up holding time. After that, the main setpoint SP is controlled. If a disturbance reduced the process value, the start-up circuit is activated again.

4 KS 50-1

SPECIAL FUNCTIONS

Boost-Function

The boost function provides a short-term increase of the set-point, e.g. with hot runner control, in order to clear nozzles of "frozen" rests of material.

Start-up circuit

For temperature control, e.g. with hot runners. High-performance heating elements with magnesium oxide insulation must be heated slowly, to remove any humidity and to prevent destruction.

Modbus Master

The KS 90-1 can be configured as Modbus Master. This enables it to transmit user-specified signals or parameters cyclically to all connected Slave controllers. For example, the following applications are possible:

- Set-point shifting relative to the set-point adjusted in the Slave (see picture)
- matching of control parameters, limit contacts, etc.
- Limiting the output value (override control OVC)
- •

LIMIT SIGNALLING FUNCTIONS

Max., Min. or Max./Min. monitoring with adjustable hysteresis.

Signals which can be monitored:

- Process value
- Control deviation
- Control deviation with suppression during start-up or set-point changes
- Effective set-point
- Output signal Y
- Control deviation always compared to internal setpoint SP even if SP2 or SP.E is activated.


Functions

- Input signal monitoring
- Input signal monitoring with latch (reset via front key or digital input)

Several limit signals or alarms can be OR-linked before being output.

Applications: Release of a brake with motor actuators, general alarms, etc.

Display and operation:

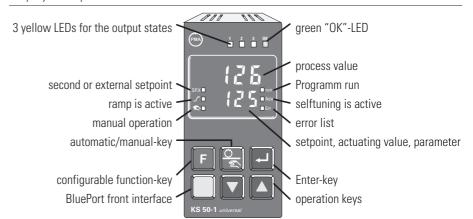

ALARMS

Heating current alarm

- Overload and short circuit
- Open circuit and short circuit

Limit value adjustable 0...9999 A

Control loop alarm

Automatic detection if there is no response of the process to a change of output value.

Sensor break or short circuit

Depending on selected input type, the input signal is monitored for break and short circuit

MAINTENANCE MANAGER

Display of error signals, warnings, and latched limit messages in the error list. Signals are latched, and can be reset manually.

Possible signals in the error list:

| 9 |
|--|
| Sensor break, short circuit, reversed polarity |
| Heating current alarm |
| Control loop alarm |
| Fault during self-tuning |
| latched limit messages |
| e.g. re-calibration warning |
| (If the adjusted operating hours are exceeded a message is displayed) |
| e.g. maintenance interval of actuator |
| (If the adjusted switching cycles are exceeded a message is displayed) |
| Internal fault (RAM, EEPROM,) |
| |

Flashing Error LED indicates active alarm in the error list:



OPERATION AND DISPLAY

Display

Process value: LED with 7 segments, 10,5 mm Lower display: LED with 7 segments, 7,8 mm

Operating functions

The functions of the \(\bigsep\)-key and the \(\bigsep\)-key are configurable:

| Function | 0 | F |
|--|---|---|
| Remote (no front operation) | | Х |
| SP.2 (2nd setpoint) | | Х |
| Y.2 (2nd output value) | Х | Χ |
| SP.E (external setpoint) | Х | Х |
| Manual operation | Х | Х |
| C.OFF (controller function off) | Х | Х |
| Lock of manual key | | Х |
| Reset of latched limits and error list | Х | Х |
| Boost | | Х |
| Parameter set ½ | | Х |
| Programmer run/stop | | Х |

Several functions can be combined e.g. SP.2 and parameter set switch-over (gain scheduling) with only one key.

KS 50-1 5

POWER SUPPLY

Depending on version:

AC SUPPLY

Voltage: 90...260 VAC Frequency: 48...62 Hz Power consumption approx. 7 VA

UNIVERSAL SUPPLY 24 V UC

AC voltage: 20,4...26,4 VAC Frequency: 48...62 Hz DC voltage: 18...31 V DC Power consumption: approx: 7 VA (W)

BEHAVIOUR WITH POWER FAILURE

Configuration, parameters, and adjusted set-points, control mode: Non-volatile storage in EEPROM

BluePort FRONT INTERFACE

Connection of PC via PC adapter (see "Accessories"). The BlueControl software is used to configure, set parameters, and operate the KS 50-1.

BUS INTERFACE (OPTION)

Galvanically isolated

Physical: RS 422/485 Protocol: Modbus RTU

Transmission speed: 2400, 4800, 9600, 19.200 bits/s

00...99 Address range: Number of controllers per bus: 32 Repeaters must be used to connect more controllers

ENVIRONMENTAL CONDITIONS

Protection modes

Front panel: IP 65 (NEMA 4X)

Housing: IP 20 Terminals: IP 00

Permissible temperatures

For specified accuracy: 0...60°C Warm-up time: < 15 minutes Temperature effect: < 100ppm/K -20...65°C For operation: For storage: -40...70°C

Humidity

75% yearly average, no condensation

Shock and vibration

Vibration test Fc (DIN 68-2-6)

10...150 Hz Frequency: Unit in operation: 1g or 0,075 mm Unit not in operation: 2g or 0,15 mm

Shock test Ea (DIN IEC 68-2-27)

Shock: 15g Duration: 11ms

Electromagnetic compatibility

Complies with EN 61 326-1 (for continuous, unattended operation)

GENERAL

Housing

Material: Makrolon 9415,

flame-retardant

Flammability class: UL 94 VO, self-extinguishing

Plug-in module, inserted from the front

Safety tests

Complies with EN 61010-1 (VDE 0411-1): Over voltage category II Contamination class 2 Working voltage range 300 VAC Protection class II

Certifications

Type test to DIN 3440 and Pressure Equipment Directive 97/23/EC (applied

With certified sensors it can be used in:

- Heat generating plants with outflow temperatures up to 120°C to DIN
- Hot-water plants with outflow temperatures above 110°C to DIN
- Thermal transfer plants with organic transfer media to DIN 4754
- Oil-heated plants to DIN 4755

cUL certification

(Type 4x, indoor use)

Electrical connections

Depending on version:

- Flat-pin connectors 1 x 6,3 mm or 2 x 2,8 mm to DIN 46 244
- Screw terminals for conductor cross-section from 0.5 to 2.5 mm²

Mounting

Panel mounting with two fixing clamps at top/bottom or left/right Close mounting possible

Mounting position: not critical Weight: 0,27 kg (9.52 oz)

Accessories supplied with unit

Operating instructions 2 fixing clamps

ACCESSORY EQUIPMENT BlueControl (Engineering Tool)

PC-based program for configuring, setting parameters, and operating (commissioning) the KS 50-1 controller. Moreover, all the settings are saved, and can be printed on demand.

Depending on version, a powerful data acquisition module is available, complete with trend graphics.

Software requirements: Windows 95/98/NT/2000.

BlueControl, versions and functionality:

| FUNCTIONALITY | MINI | BASIC | EXPERT |
|---|----------|-------|--------|
| parameter and configuration setting | yes | yes | yes |
| controller and loop simulation | yes | yes | yes |
| download: trnsfer of an engineering to the controller | yes | yes | yes |
| online mode/ visualization | SIM only | yes | yes |
| defining an application specific linearization | yes | yes | yes |
| configuration in the extended operating level | yes | yes | yes |
| upload: reading an engineering from the controller | SIM only | yes | yes |
| basic diagnostic functions | no | no | yes |
| saving data file and engineering | no | yes | yes |
| printer function | no | yes | yes |
| online documentation, help | yes | yes | yes |
| implementation of measurement value correction | yes | yes | yes |
| data acquisition and trend display | SIM only | yes | yes |
| wizard function | yes | yes | yes |
| extended simulation | no | no | yes |
| | | | |
| programmeditor (KS 90-1prog only) | no | no | yes |

6 KS 50-1 The built-in simulation serves to test the controller settings, but can also be used for general training and observing the interaction between controller and control loop.

Configurations that can only be implemented via the BlueControl software (not via the front-panel keys):

- Customer-specific linearizations
- Enable "forcing" for inputs/outputs.
 Forcing allows to write the analog and digital inputs and outputs via Modbus interface.
- Adjustment of limits for operating hours and switching cycles
- Switch-over to 60 Hz mains frequency
- Master/slave configuration
- Disable operator actions and operating levels, plus password definition
- Prevent automatic optimization of cycle times T1, T2

Hardware requirements:

A PC adapter (see "Accessories") is required for connecting the controller.

Updates and demo software can be downloaded from: www.pma-online.de

ORDERING INFORMATION

| K S 5 0 - 1 | 1 - 0 0 - |
|--|-----------|
| Flat pin connector | |
| Screw terminals | 1 |
| 90250V AC, 3 relays | 0 |
| 24VAC / 1830VDC, 3 relays | 1 |
| 90250V AC, 2 relays + mA/V/logic | 2 |
| 24VAC / 1830VDC, 2 relays + mA/V/logic | 3 |
| No option | 0 |
| Modbus RTU + U_T + di2/3 + OUT5/6 | 1 |
| Standard configuration | 0 |
| Configuration to specification | 9 |
| No manual | 0 |
| manual german | D |
| manual english | E |
| manual french | F |
| Standard | 0 |
| UL certified (with screw terminals only) | U |
| DIN 3440 | D |
| Standard version | 00 |
| Customer specification | |

ACCESSORIES

| Description | | Order no. |
|--|-----------------------------|-------------------|
| Current converter 50A AC | | 9404-407-50001 |
| PC adapter, for connecting the BlueControl | ol software to the BluePort | 9407-998-00001 |
| Standard rail adapter | | 9407-998-00061 |
| Operating manual | German | 9499-040-62818 |
| Operating manual | English | 9499-040-62811 |
| Operating manual | French | 9499-040-62832 |
| BlueControl Mini | German/English/French | www.pma-online.de |
| BlueControl Basic | German/English/French | 9407-999-11001 |
| BlueControl Expert | German/English/French | 9407-999-11011 |

KS 50-1 7



PMA

Prozeß- und Maschinen- Automation GmbH P.O. Box 31 02 29 D-34058 Kassel

Tel.: +49 - 561- 505 1307 Fax: +49 - 561- 505 1710 E-mail: mailbox@pma-online.de Internet: http://www.pma-online.de

Your local representative: